

**NO: 09-09-96**

**SUBJECT: MIL Light Illumination - Power Steering Switch Failure**

**DATE: Sep. 13, 1996**

**NOTE: THIS BULLETIN APPLIES TO VEHICLES EQUIPPED WITH 2.5L ENGINES.**

**SYMPTOM/CONDITION:**

MIL light may illuminate indicating DTG code \$73 - SAE Trouble Code P0551, power steering switch failure.

**DIAGNOSIS:**

If the MIL light has been illuminated and the codes described above are present, perform the appropriate powertrain diagnostic procedures outlined in the Powertrain Diagnostic Procedures manual using the DRB III or Mopar Diagnostic System. If no problems are indicated, perform the Repair Procedure.

**PARTS REQUIRED:**

Quantity	Part No.	Description
1	056027906AB	Switch

**REPAIR PROCEDURE:**

This bulletin involves replacing the power steering pressure switch. A new power steering switch has been released which is recalibrated to activate at a higher pressure.

1. Make sure that the engine is not running and disconnect the electrical connector from the switch, located on the power steering hose near the pump.
2. Remove the switch using a rag to catch any fluid which may drip from the fitting..
3. Install the new switch, PIN 056027906AB, tightening the switch to 14 m (125 in. Lbs.).
4. Connect the electrical connector to the switch.
5. Start the engine and check the power steering fluid level and check for leaks. Make any corrections necessary.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No.	Time
08-80-72-90	0.4 Hrs.

**FAILURE CODE:**

Code	Description
P8	New Part