

**NO: 19-03-96**

**SUBJECT: Power Steering Reservoir Fluid Seepage**

**DATE: June 28, 1996**

**SYMPTOM/CONDITION:**

Power steering fluid may seep from the bottom of the power steering fluid reservoir.

**DIAGNOSIS:**

Inspect the reservoir. If fluid seepage is present perform the Repair Procedure.

**PARTS REQUIRED:**

Quantity	Part No.	Description
1	52087713AB	Power Steering Reservoir
1	2448761	Clamps
AR	4856976	Power steering Fluid

**REPAIR PROCEDURE:**

This bulletin involves installing an improved power steering reservoir.

1. Drain the fluid from the power steering reservoir.
2. Remove the power steering hose clamps from the hoses at the reservoir and remove the hoses.
3. Remove the reservoir from the bracket and discard it.
4. Install the new reservoir P/N 52087713AB.
5. Install the hoses using the clamp P/N 2448761.
6. Fill the system with power steering fluid P/N 4856976.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No.	Time
19-70-55-90	0.4 Hrs.

**FAILURE CODE:**

Code	Description
P8	New Part